

# **ID-H0530/0560**

## **Digimatic Indicator**

# **User's Manual**

Read this User's Manual thoroughly  
before operating the instrument. After reading,  
retain it close at hand for future reference.

**Mitutoyo**

---

## FOREWORD

---

In order to use this Digimatic Indicator properly, read this manual thoroughly before operating the instrument. After reading this manual, store it in a safe place for future reference.

Mitutoyo assumes no liability to any party for any loss or damage, direct or indirect, caused by use of this instrument not conforming to this manual.

Information in this document is subject to change without notice.

© 2013 Mitutoyo Corporation. All rights reserved.

## PRECAUTIONS

---

### Precautions against the Power Supply

Wrong handling that neglects the following precautions could result in serious injury or death.



- This instrument is externally powered from the AC power supply via the AC adapter. Be sure to use the Mitutoyo specified AC adapter (standard accessory: No.06AEG180).
- If this instrument is used near the machines that require a high voltage, high frequency, or large current, do not share the power line of the AC adapter with those machines.
- Use the AC power supply that absolutely conforms to the voltage and frequency indicated on the AC adapter. If the AC adapter is used under the condition exceeding the permissible voltage range, it could cause an explosion or ignition.
- If this instrument is not used for an extended period of time, make sure that the AC adapter is unplugged from the power supply to prevent fire, etc.

### Precaution in Discarding This Instrument

Wrong handling that neglects the following precautions could result in serious injury or death.



- This instrument uses liquid crystal. If discarding this instrument, observe the ordinance and regulation by each local government.
- The liquid crystal includes an irritating substance. Should any liquid content be accidentally applied to your eyes or skin, wash them with clean flowing water. If you swallow the liquid content, immediately rinse your mouth, and after drinking a large amount of water, vomit it, and then consult a doctor.

### Precaution for Use

The following acts or circumstances will cause a failure or a malfunction in this instrument. Care should be exercised.

- IMPORTANT
- Do not apply a sudden impact such as a drop or excessive force to this instrument.
  - Do not disassemble or retrofit the instrument.
  - Do not operate keys with a sharp tip (such as the tip of a screwdriver or ball point pen).
  - Avoid using and storing this instrument at sites where it is subject to direct sunlight and excessively hot or cold environments.
  - The use of this instrument at a site with tenuous air or high pressure could cause a failure due to deterioration in material.

- 
- Avoid storing the instrument at sites surrounded with high humidity and dust, and avoid using it at sites where it is subject to direct splashes of water and oil.
  - If a high-voltage device such as an electric pen is used, electronic parts may be damaged. Also, using the instrument at a site where large electric noises are generating could cause a malfunction.
  - Use this instrument at a site with minimum vibration while securely fixing it on the comparator stand.
  - Do not use this instrument in such a way that a perpendicular load or a twisting force is applied to the spindle.
  - To clean the instrument, use a dry soft cloth or cotton swab, or one soaked in diluted neutral detergent. Use of organic solvents (such as thinner or benzene) may result in failure.
  - The dirt in the spindle and cylinder will cause a malfunction.
  - Wipe off dirt on the spindle with a cloth damped with alcohol, and then lightly wipe the spindle with a cloth damped with a small amount of low-viscosity oil.
  - Clean the inside of the cylinder periodically. After removing the cylinder by rotating it, brush off the dust and dirt on and around the piston and in the cylinder using a brush or a blower brush.
  - Take sufficient damage-preventive measures (safety measures) for an accidental failure of this instrument.
- 

The following precautions are important to obtain correct measurement results. Care should be taken.

#### **IMPORTANT**

- Perform sufficient thermal stabilization of this instrument and an object to be measured before starting measurement. Use this instrument at a site which is subject to as little thermal fluctuation as possible.
  - To perform stabilized measurement, allow approximately 20 minutes after turning on the power. The base line could be drifted approximately  $0.5 \mu\text{m}$ .
  - Do not use this instrument with either stroke end specified as the reference point.
  - Note that, if this instrument is used in other than the specified conditions, the functions and performance will not be guaranteed.
- 

## **WARRANTY**

This Digimatic indicator has been manufactured under Mitutoyo's rigorous quality control system. In the event that this instrument should fail within one year from the original date of purchase through normal use, we will repair or replace it at our option, free of charge, upon its prepaid return to Mitutoyo. Contact your dealer or the nearest Mitutoyo Service Center.

However, the following failure or damage may be subject to a repair charge even within the warranty period:

- 1 Unit failure or damage arising from improper handling, or unauthorized retrofit or repair by the user.
- 2 Unit failure or damage as the result of moving, dropping, or transporting after purchase.
- 3 Unit failure or damage due to fire, salt, gas, abnormal voltage, or natural catastrophe.

This Warranty is valid only in the country of original purchase.

## **NOTES ON OVERSEAS TRANSFER**

Please contact Mitutoyo before transferring it abroad.

---

# Contents

---

<b>FOREWORD .....</b>	<b>i</b>
<b>PRECAUTIONS .....</b>	<b>i</b>
<b>WARRANTY .....</b>	<b>ii</b>
<b>NOTES ON OVERSEAS TRANSFER .....</b>	<b>ii</b>
<b>1 NAME OF EACH PART .....</b>	<b>1-1</b>
1.1 Part Names of the Main Unit .....	1-1
1.2 Details of the LCD Unit .....	1-2
<b>2 INSTALLATION.....</b>	<b>2-1</b>
2.1 Attaching the Clamp Filter.....	2-1
2.2 Mounting on a Stand or a Jig .....	2-1
2.2 Attaching the Lifting Lever.....	2-1
2.3 Attaching the Release.....	2-2
2.4 Mounting the Lug or Special Back .....	2-2
2.5 Replacing the Contact Point .....	2-2
<b>3 OPERATING PROCEDURE .....</b>	<b>3-1</b>
3.1 Starting/Stopping This Instrument .....	3-1
3.1.1 Connecting to the power supply .....	3-1
3.1.2 Start / Stop.....	3-1
3.2 Parameter Setup Mode .....	3-1
3.2.1 Switching the unit system between inch and mm during display of “unit” (only in inch spec)....	3-2
3.2.2 Switching the digital resolution during display of “res.” .....	3-2
3.2.3 Switching the analog range (analog resolution) during display of “range” .....	3-3
3.2.4 Switching the count direction during display of “dir” .....	3-3
3.2.5 Switching the I/O format between SPC(Digimatic) and RS-232 during display of “output” .....	3-3
3.2.5.1 RS-232 setup.....	3-3
3.2.6 Setting ID No. for RS-232 communication and remote control during display of “id” ..	3-4
3.2.7 Switching the length measuring system during display of “start” .....	3-4
3.2.8 Returning all parameters to factory defaults during display of “reset” .....	3-4
3.3 Measurement Mode.....	3-5
3.3.1 Setting the length measuring system and reference point .....	3-5
3.3.1.1 INC system (Zero set) .....	3-5
3.3.1.2 Preset system (setting the preset value) .....	3-5
3.3.2 Switching a measurement type in the measurement mode .....	3-6
3.3.2.1 Tolerance judgment (setting/checking the upper and lower limit values) .....	3-6
3.3.2.2 Run-out peak hold during display of “TIR” .....	3-7
3.3.2.3 Maximum value peak hold during display of “Max” .....	3-7
3.3.2.4 Minimum value peak hold during display of “Min” .....	3-8
3.3.3 Data output / Data hold .....	3-9

---


3.3.4	Function lock.....	3-9
3.3.5	Centering the pointer.....	3-9
3.4	Operation with the Remote Control (Option).....	3-9
4	DATA INPUT/OUTPUT.....	4-1
4.1	SPC (Digimatic) Input/Output.....	4-1
4.1.1	Connecting procedure.....	4-1
4.1.2	I/O connector.....	4-1
4.1.3	Output data format (DATA1).....	4-2
4.1.4	Timing chart.....	4-2
4.2	RS-232 Input/Output.....	4-4
4.2.1	Connecting procedure.....	4-4
4.2.2	I/O connector.....	4-4
4.2.3	Communication specification.....	4-4
4.2.4	Communication command (I/O format).....	4-5
4.2.5	Communication sample .....	4-7
5	ERROR MESSAGE AND ACTION .....	5-1
6	SPECIFICATION .....	6-1
6.1	Specifications of the main unit .....	6-1
6.2	Standard accessories .....	6-1
6.3	Optional accessories .....	6-2

# 1

## NAME OF EACH PART


This chapter describes the name of each part and the LCD display contents.

### 1.1 Part Names of the Main Unit

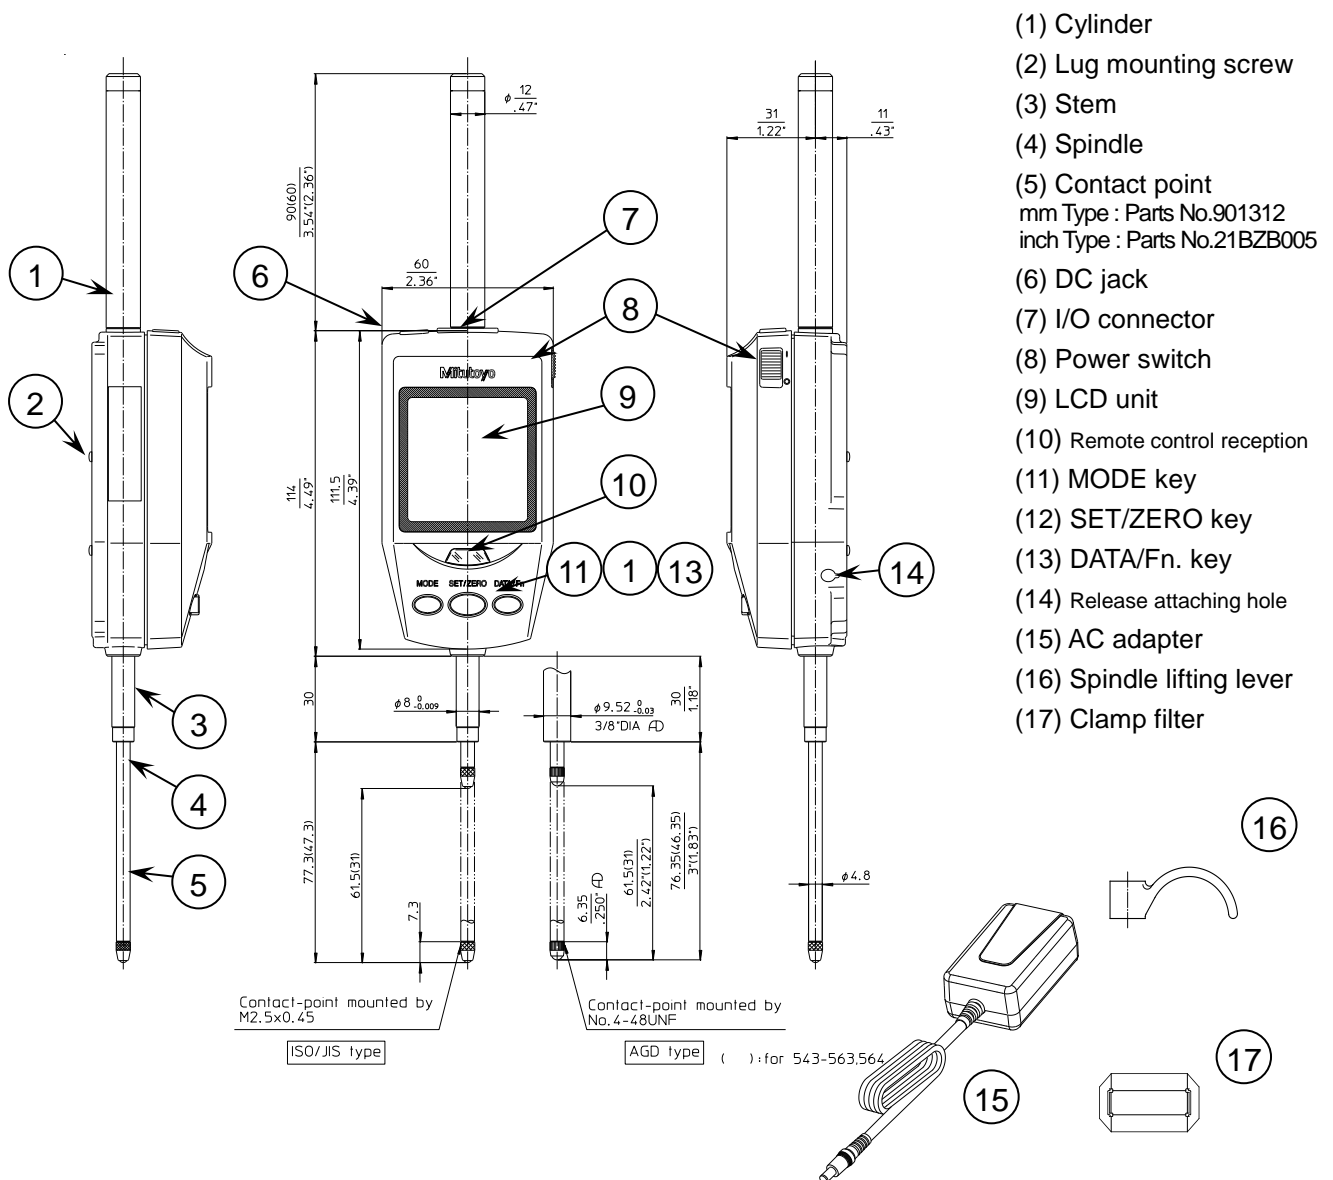

**NOTE** • Be sure to attach the clamp filter (ferrite core) to the AC adapter. For detailed information about attachment, refer to section "2.1 Attaching the Clamp Filter".

## 1.2 Details of the LCD Unit

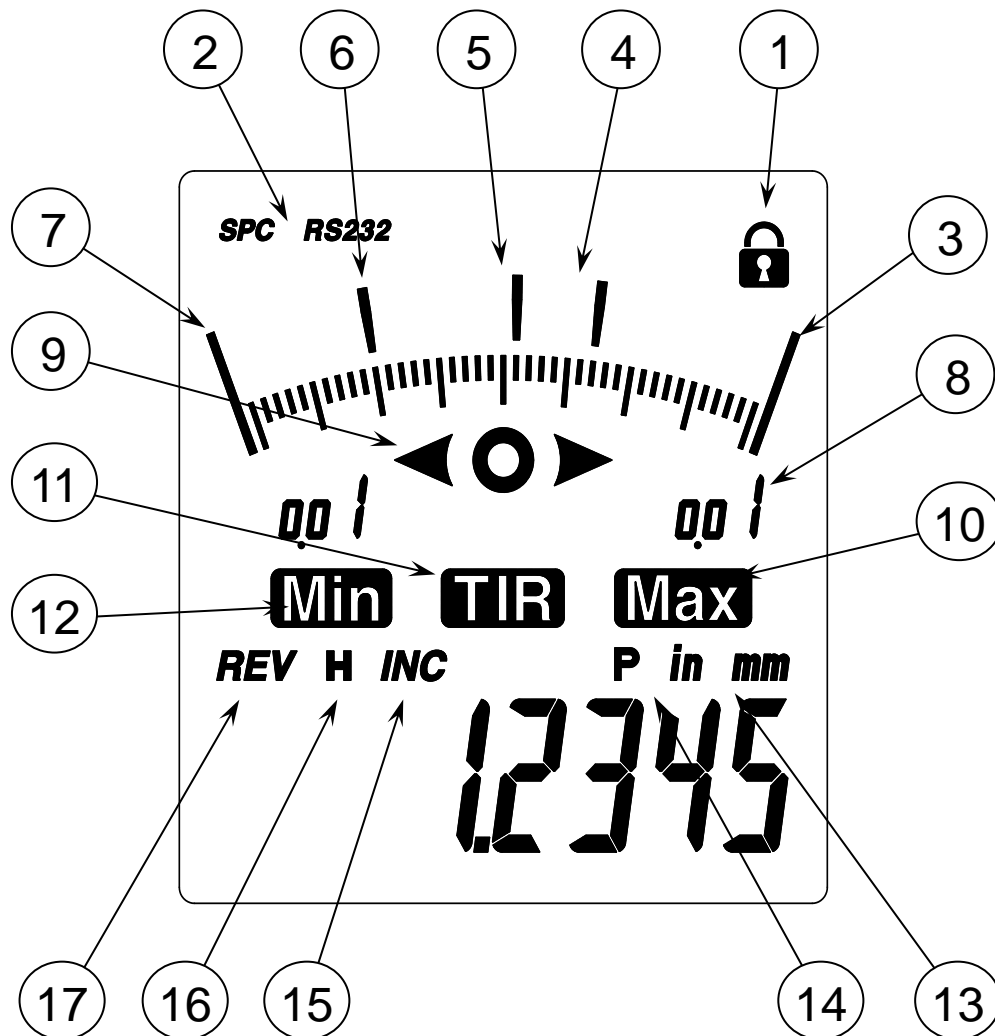

- |                                     |                                    |                                     |
|-------------------------------------|------------------------------------|-------------------------------------|
| (1) Function lock                   | (2) Output format display          | (3) Upper over-range                |
| (4) Upper pointer                   | (5) Pointer                        | (6) Lower pointer                   |
| (7) Lower over-range                | (8) Analog range                   | (9) Tolerance judgment              |
| (10) Maximum value hold measurement | (11) Runout hold measurement       | (12) Minimum value hold measurement |
| (13) Display value unit             | (14) Preset value setup mode       | (15) Comparison measurement         |
| (16) Data hold mode                 | (17) Reverse direction measurement |                                     |

- NOTE**
- When tolerance judgment measurement is performed, the upper pointer (4) and lower pointer (6) blink at slow intervals to indicate the upper limit value and lower limit value, respectively.
  - In the total runout, maximum value, or minimum value hold measurement mode, the upper pointer (4) and lower pointer (6) blink to indicate the maximum value and minimum value, respectively.
  - If the pointer (5) coincides with the upper pointer (4) and lower pointer (6), these pointers blink at quick intervals.


# 2

## INSTALLATION

This chapter explains how to mount this Digimatic indicator on a stand or a jig and how to attach or replace optional accessories.

### 2.1 Attaching the Clamp Filter

Use this instrument by wrapping the AC adapter cord around the clamp filter (ferrite core) as shown in the figure below.

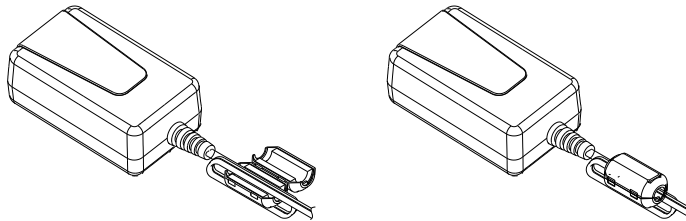

### 2.2 Mounting on a Stand or a Jig


Use this instrument with its stem being clamped on the comparator stand (option) or an appropriate jig.

**IMPORTANT** • If possible, avoid fixing the stem by directly clamping it with a clamp screw, etc. If the stem is clamped with a tightening torque of 150cN•m or more, the indicator could cause a malfunction.

**NOTE** • Clamp the stem so that the spindle is oriented perpendicularly with respect to the reference plane and a measuring surface. If the axis line (spindle) is not perpendicular to the reference plane (measuring surface), an error is added to a measured value. For example, assuming a tilt angle of the axis line from the reference plane as  $\psi$ , error  $\delta$  per measuring length 30mm will be the following according to the tilt angle:  $\psi = 1^\circ$ :  $\delta = 0.0045\text{mm}$ ,  $\psi = 2^\circ$ :  $\delta = 0.0185\text{mm}$ , and  $\psi = 3^\circ$ :  $\delta = 0.0410\text{mm}$ .  
• To mount this indicator on a jig, it is recommended that the stem be clamped with a slotted holder that has a coupling portion of approximately  $\phi 8\text{G7}$  (AGD:  $\phi 9.52$ ) +  $0.02/+0.005\text{mm}$ .

### 2.3 Attaching the Lifting Lever

While holding the spindle from the counter side (B) so as not to bend it, engage the spindle with the groove on the lifting lever (No.137693/standard accessory).

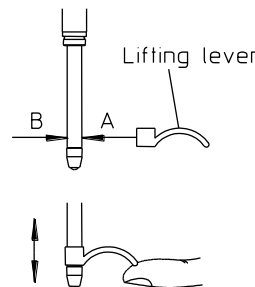



---

## 2.4 Attaching the Release

Remove the rubber cap in the release attaching hole, and then screw in the release (No.540774/option) by hand.

- 
- IMPORTANT**
- Do not pull or hit the release strongly. Some screw thread at its end may break.
  - Inserting any other than the release or applying excessive force to the release mount could result in failure.
- 

- 
- NOTE**
- The amount of lifting the spindle when using the release is approximately 30mm from the bottom dead center.
- 

## 2.5 Mounting the Lug or Special Back

This Digimatic indicator can be equipped with the back with lug (No.101040: ISO/JIS type or No.101306: ANSI/AGD type, both options) for Mitutoyo standard dial indicators or either of various special backs.

Remove the four screws on the rear and mount the back with lug with these screws.


- 
- NOTE**
- For information about the assortment of accessories such as special backs, special contact points, and extension rods, refer to the Mitutoyo general catalog, measuring tool general catalog, or dial indicator catalogs.
- 

## 2.6 Replacing the Contact Point

Various special contact points and extension rods of Mitutoyo dial indicator options are available.

Hold the spindle with pliers while placing a waste cloth between them so that the spindle will not rotate, and then detach/attach the contact point by pinching and rotating it with other pliers.

- 
- IMPORTANT**
- Unless the spindle is held unturned in the above procedure, a failure could be caused in the Digimatic indicator. Causing damage to the spindle could result in a malfunction.
  - Upon replacement of the contact point the external dimensions, measuring force, measuring orientation restriction, etc., of the indicator may be changed.
  - When the contact point other than the standard contact point is used, the error may be added due to the shape of the contact point. (e.g. Perpendicularity of the contact point and parallelism with the reference surface for the flat contact point, runout of the roller contact point, etc.)
- 

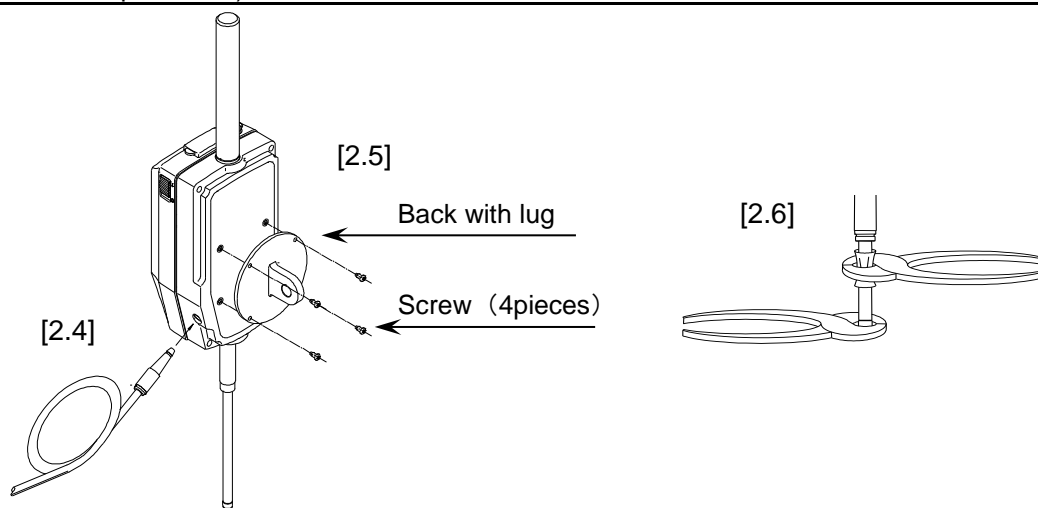

# 3

## OPERATING PROCEDURE

This chapter explains the operating procedure of the Digimatic indicator.

### 3.1 Starting/Stopping This Instrument

#### 3.1.1 Connecting to the power supply

- 1 Remove the DC jack cover located at the upper on the Digimatic indicator ID-H, and then push in the DC plug of the AC adapter (standard accessory) all the way until it stops.
- 2 Plug the AC plug at the other end of the AC adapter firmly into an AC outlet or extended outlet strip.

**IMPORTANT** • To supply or shut off the power to this instrument, be sure to turn it on or off with the [ON/OFF] switch on the side of the main body. If the power to the instrument is shut off during operation, damage to its internal parts could result.

#### 3.1.2 Start / Stop

- 1 Slide the [ON/OFF] switch on the side of the main body upward or downward to start (restart) or stop (terminate) measurement with this instrument.
- 2 To start measurement, slide the [ON/OFF] switch upward.
- 3 To stop measurement, slide the [ON/OFF] switch downward.

### 3.2 Parameter Setup Mode

Parameters such as "Digital resolution" and "Counting direction" can be changed in the Parameter Setup mode.

To put this instrument in the Parameter Setup mode, observe the following procedure.

- 1 Press and hold the [MODE] key for a long time (2 seconds or more) in the Measurement mode. Then, the mode is switched to the Parameter Setup mode, the "res." ("unit" for inch spec) symbol is blinking on the LCD.
- 2 Press and release the [MODE] key quickly (for less than 2 seconds) to change setup items.
- 3 When the item to be set is displayed, press the [SET/ZERO] key quickly, then change the setting.
- 4 When the setting of a desired setup item has been changed, press and hold the [MODE] key for a long time to return to the Measurement mode.

**NOTE** • The setting contents remain in memory even when the power is turned off.

Parameter Setup List

Reference	Display	Notation in the manual	Setup content	Default (Factory defaults)
3.2.1	<i>unit</i>	"unit"	(Only for inch spec) Switching the unit system between inch and mm	"in" (Only for inch spec)
3.2.2	<i>res</i>	"res."	Switching the digital resolution	mm spec: 0.0005 Inch spec: 0.00002
3.2.3	<i>range</i>	"range"	Switching the analog range	mm spec: 0.01 Inch spec: 0.0004
3.2.4	<i>dir</i>	"dir"	Switching the count direction	" " (No display: + direction)
3.2.5	<i>outPut</i>	"output"	Switching the I/O format between SPC and RS232	SPC (Digimatic)
3.2.6	<i>id- 00</i>	"id"	Setting ID No. for RS232 communication remote control	00
3.2.7	<i>Start</i>	"start"	Switching the length measuring system between INC and preset systems.	INC
3.2.8	<i>reset</i>	"reset"	Returning parameters to defaults.	

### 3.2.1 Switching the unit system between inch and mm during display of "unit" (only in inch spec)

- 1 Put the instrument in the Parameter Setup mode, and then quickly press and release the [MODE] key repeatedly until "unit" on the LCD starts blinking.
- 2 Quickly pressing the [SET/ZERO] key changes "unit" from blinking to lighting-up and blinks the currently-set unit system.
- 3 Press the [MODE] key quickly to switch to a desired unit (in or mm).
- 4 Quickly press the [SET/ZERO] key to apply the setting and switch the setup item to the next "res."

### 3.2.2 Switching the digital resolution during display of "res."

- 1 Put the instrument in the Parameter Setup mode, and then quickly press and release the [MODE] key repeatedly until "res." on the LCD starts blinking.
- 2 Press the [SET/ZERO] key quickly to blink the currently-set digital resolution.
- 3 Press the [MODE] key quickly to switch the setting to a desired resolution.

Unit system	Selectable resolution		
mm	0.0005mm	0.001mm	
inch (only for inch spec)	.00002"	.00005"	.0001"

- 4 Quickly press the [SET/ZERO] key to apply the setting and switch the setup item to the next "range".

#### IMPORTANT

- Upon switchover of the current unit system or digital resolution, this instrument automatically makes conversions of the preset values and tolerance limit values. After changing such a parameter, be sure to check the converted values.

#### 3.2.3 Switching the analog range (analog resolution) during display of “range”

- 1 Put the instrument in the Parameter Setup mode, and then quickly press and release the [MODE] key repeatedly until “range” on the LCD starts blinking.
- 2 Quickly pressing the [SET/ZERO] key changes “range” from blinking to lighting-up and blinks the currently-set analog range.
- 3 Press the [MODE] key quickly to switch the setting to a desired analog range.

Digital resolution	Selectable analog range						
0.0005mm	±0.01	±0.02	±0.05	±0.1	±0.2	±40	±80
0.001mm	±0.02	±0.04	±0.1	±0.2	±0.4	±40	±80
.00002"	±.0004	±.0008	±.002	±.004	±.008	±2	±4
.00005"	±.001	±.002	±.004	±.01	±.02	±2	±4
.0001"	±.002	±.004	±.01	±.02	±.04	±2	±4
RS-232 command *	A01	A02	A05	A10	A20	AFS	AFL

\*: For information about RS-232 commands, refer to section 4.2.4.

- 4 Quickly press the [SET/ZERO] key to apply the setting and switch the setup item to the next “dir”.

#### 3.2.4 Switching the count direction during display of “dir”

- 1 Put the instrument in the Parameter Setup mode, and then quickly press and release the [MODE] key repeatedly until “dir” on the LCD starts blinking.
- 2 Quickly pressing the [SET/ZERO] key changes “dir” from blinking to lighting-up. Only “dir” is displayed if the currently-set direction is “+” count, and “REV” blinks at the left of “dir” if the direction is “-” count.
- 3 Press the [MODE] key quickly to switch the setting to a desired direction (between + and -).
- 4 Quickly press the [SET/ZERO] key to apply the setting and switch the setup item to the next “output”.

**NOTE** • Upon change of the count direction, the sign (+/-) of a display value is also changed. Before calling a preset value, perform setup of the count direction.

#### 3.2.5 Switching the I/O format between SPC(digimatic) and RS-232 during display of “output”

- 1 Put the instrument in the Parameter Setup mode, and then quickly press and release the [MODE] key repeatedly until “output” on the LCD starts blinking.
- 2 Quickly pressing the [SET/ZERO] key changes “output” from blinking to lighting-up and blinks the currently-set I/O format.
- 3 Press the [MODE] key quickly to switch the setting to a desired I/O format (between SPC and RS-232).
- 4 Quickly press the [SET/ZERO] key to apply the setting and switch the setup item to the next “id” (section 3.2.6) if SPC is specified. If RS-232 is specified as the I/O format, the procedure is continuously switched to the RS-232 setup (section 3.2.5.1).

##### 3.2.5.1 RS-232 setup

- 1 When the procedure is switched to the RS-232 setup, “bps” starts blinking.
- 2 Press the [SET/ZERO] key quickly to blink the currently-set baud rate.
- 3 Press the [MODE] key quickly to switch the setting to a desired baud rate (4800 or 9600).
- 4 Quickly press the [SET/ZERO] key to apply the communication setting and switch the setup item to the next “p-bit.”.
- 5 Referring to the following table, set the parity bit and data bit according to the

procedure in steps 2 to 4.

Setup item	Display	Setup content		
Baud rate (Bit rate)	<i>bPS</i>	4800bps	9600bps	
Parity bit	<i>P.-bit</i>	0 (none)	1 (odd)	2 (even)
Data bit	<i>d-bit</i>	7 bits	8 bits	

6 When the data bit setting has been applied, the setup item is switched to the next "id".

**NOTE** • Initial setting (factory defaults) for RS-232 is as follows:  
Bit rate: 9600bps Parity bit: even Data bit: 7bit

### 3.2.6 Setting ID No. for RS-232 communication and remote control during display of "id"

- 1 Put the instrument in the Parameter Setup mode, and then quickly press and release the [MODE] key repeatedly until "id" on the LCD starts blinking.
- 2 Quickly pressing the [SET/ZERO] key changes "id" from blinking to lighting-up and blinks the currently-set ten's place of ID No.
- 3 Press the [MODE] key quickly to switch the ten's place to a desired number (0 to 9).
- 4 Press the [SET/ZERO] key quickly to apply the specified number and blink the current unit's place of ID No.
- 5 Press the [MODE] key quickly to switch the unit's place to a desired number (0 to 9).
- 4 Quickly press the [SET/ZERO] key to apply the setting and switch the setup item to the next "start".

**NOTE** • When the ID No. of the instrument has been set, only the signals from the remote control and RS-232 communication with the same ID No. are received. If ID No. on the remote control and RS-232 communication sides is set to "00", however, the instrument receives any signals irrespective of its ID No.  
• The remote control (option) ID No. can be set to one of "00" to "07" or "09" to "15".  
• The RS-232 communication ID No. can be set to one of "00" to "09".

### 3.2.7 Switching the length measuring system during display of "start"

- 1 Put the instrument in the Parameter Setup mode, and then quickly press and release the [MODE] key repeatedly until "start" on the LCD starts blinking.
- 2 Quickly pressing the [SET/ZERO] key changes "start" from blinking to lighting-up and blinks the currently-set length measuring system.
- 3 Press the [MODE] key quickly to switch the setting to a desired length measuring system.

Display	Setup content
Baud rate (Bit rate)	Always starts up under the INC system.
" (no display)	Starts up under the length measuring system at the most recent shutdown.

- 4 Quickly press the [SET/ZERO] key to apply the setting and switch the setup item to the next "reset"

### 3.2.8 Returning all parameters to factory defaults during display of "reset"

- 1 Put the instrument in the Parameter Setup mode, and then quickly press and release the [MODE] key repeatedly until "reset" on the LCD starts blinking.
- 2 When pressing the [SET/ZERO] key quickly, "no" on the LCD starts blinking.
- 3 To return the parameters to defaults, press the [MODE] key quickly to switch to "yes" under blinking.

- 4 Quickly press the [SET/ZERO] key to restore the defaults and switch the setup item to the next "res." ("unit" in inch spec).

**IMPORTANT**

- When resetting the parameters, the preset values and the upper and lower tolerance limit values are also cleared. Set these values again.
- Do not reset during RS-232 communication. Since the "I/O format" and "ID No." are changed, RS-232 communication will not be conducted any more.

## 3.3 Measurement Mode

### 3.3.1 Setting the length measuring system and reference point

This instrument has two length measuring systems, INC (Comparison) system and Preset system.

Press and hold the [SET/ZERO] key for a long time in the normal measurement mode or the tolerance judgment mode to switch the length measuring system between INC and Preset systems.

**NOTE**

- The "INC" symbol lights up under the INC system and goes off under the Preset system.
- To set the reference point, make sure that this instrument is clamped securely with the spindle pushed in slightly.

#### 3.3.1.1 INC system (Zero set)

In the INC system, the instrument measures a distance from the zero-set position.

When the [SET/ZERO] key is pressed quickly in the normal measurement mode or the tolerance judgment mode, the instrument is zero-set at the current position.

#### 3.3.1.2 Preset system (setting the preset value)

In the Preset system, the instrument measures a distance from the reference point that has been preset with an arbitrary value (Calling the preset value).

- 1 When the [SET/ZERO] key is pressed shortly in the normal measurement mode or the tolerance judgment mode, the most recent preset value is displayed, blinking the "P" symbol.
- 2 Press the [SET/ZERO] key quickly to set the current spindle position to the preset value, putting the instrument in the measurable state.  
To change a preset value, press and hold the [SET/ZERO] key for a long time to blink the "+" or "-" symbol, entering the state where a preset value can be set. Enter a sign or a numeral observing the following procedure in steps (1) to (4).
  - (1) Quickly press the [MODE] key repeatedly until a desired sign (+ or -) or numeral is displayed.
  - (2) Quickly press the [SET/ZERO] key to apply the sign or numeral and switch the setup item to the next digit.
  - (3) Repeat the procedure in steps (1) and (2) to enter a numeral in all digits. When the least significant digit has been decided, the "P" symbol blinks up.
  - (4) Press the [SET/ZERO] key quickly to set the current spindle position to the preset value, putting the instrument in the measurable state.




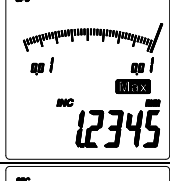
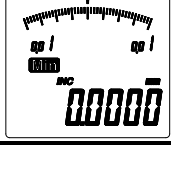
**NOTE**

- The setting contents remain in memory even when the power is turned off.
- Press and hold the [MODE] key for a long time in the process of presetting to restore the state before presetting.
- Press the [SET/ZERO] key while holding down the [DATA/Fn] key to reverse the order of digits.
- Press the [MODE] key while holding down the [DATA/Fn] key to reverse the order of a numeric value.
- Preset value can be called only for the first time after switching to the preset system. It is impossible to call the preset value for the second time and afterward.

### 3.3.2 Switching a measurement type in the measurement mode

This instrument is provided with measurement mode described in the table below in addition to normal measurement mode.

Press the [MODE] key quickly to switch the measurement mode to a desired measurement type.

Reference	Measurement mode	Display	Setup content
---	Normal		Performs normal measurement.
3.3.2.1	Tolerance judgment “<O>”		Performs tolerance judgment measurement. Tolerance judgment is performed for each hold value in the runout, maximum value, and minimum value hold measurements.
3.3.2.2	Runout peak hold “TIR”		Performs peak hold measurement of the runout (total indicator reading).
3.3.2.3	Maximum value peak hold “Max”		Performs peak hold measurement of the maximum value.
3.3.2.4	Minimum value peak hold “Min”		Performs peak hold measurement of the minimum value.

#### 3.3.2.1 Tolerance judgment (setting/checking the upper and lower limit values)

Tolerance judgment is performed for the current value in the normal measurement mode, whereas it is performed for each peak hold value in each peak hold mode.

It is possible to set the upper and lower limit values separately for individual INC system and Preset system.

It is not possible to set the upper and lower limit values separately for each measurement mode.

The tolerance judgment is displayed with “< O >” and the backlight (red for NG and green for OK).

- 1 Quickly press the [MODE] key repeatedly until “< O >” on the LCD starts blinking.
- 2 When pressing the [SET/ZERO] key quickly, symbol “off” or “on” starts blinking.
- 3 Press the [MODE] key quickly to switch the blinking symbol to “on”.
- 4 Press the [SET/ZERO] key quickly. Then, the most recently-set upper limit value is displayed and the “>” symbol starts blinking.
- 5 Quickly press the [SET/ZERO] key again to apply the upper limit value and switch the setup item to the lower limit value.

To change the upper limit value, press and hold the [SET/ZERO] key for a long time to blink the “+” or “-” symbol, entering the state where the upper limit value can be set.

- The same as the procedure in section 3.3.1.2(Setting the preset value), enter a numeric value, then apply it with the [SET/ZERO] key to set the upper limit value.
- 6 When the upper limit value has been decided, the most recently-set lower limit value is displayed and the "<" symbol starts blinking.
  - 7 Quickly press the [SET/ZERO] key again to apply the lower limit value, thereby entering the state where tolerance judgment can be performed.  
To change the lower limit value, press and hold the [SET/ZERO] key for a long time to blink the "+" or "-" symbol, entering the state where the lower limit value can be set.  
The same as the procedure in section 3.3.1.2(Setting the preset value), enter a numeric value, then apply it with the [SET/ZERO] key to set the lower limit value.
  - 8 To cancel the tolerance judgment, switch the blinking symbol to "off" when "off" or "on" is blinking, and then quickly press the [SET/ZERO] key.

- NOTE**
- If tolerance limit values have been erroneously set so as to be an upper limit value < a lower limit value, "Error90" will be displayed. Press the [SET/ZERO] key shortly to clear the error, and then set tolerance limit values so as to be an upper limit value > a lower limit value.
  - Press and hold the [MODE] key for a long time in the process of tolerance setting to restore the state before setting.
- 

#### 3.3.2.2 Run-out peak hold during display of "TIR"

Hold the runout of fluctuating measurement values according to the following procedure.

When the tolerance judgment condition has been set, the instrument displays the tolerance judgment result for the measured runout.

- 1 Quickly press the [MODE] key repeatedly until "TIR" is displayed.
- 2 Press the [SET/ZERO] key shortly to blink the "TIR" symbol. Then, the runout being held is canceled and a new run-out hold measurement starts.
- 3 When the spindle is displaced, the "TIR" symbol changes from blinking to lighting-up and a runout is held.

- NOTE**
- In the tolerance judgment measurement in the run-out hold mode, tolerancing is performed by comparing the width between the upper and lower limit values that have been set (upper limit value – lower limit value) and each TIR measurement value.
  - Start a run-out, maximum value, or minimum value hold measurement with the contact point placed on a work-piece to be measured. Note that this instrument detects even a displacement due to vibration or impact with a maximum response speed of 1m/sec.
  - When switching to "TIR", "Max", and "Min" sequentially by pressing the [MODE] key quickly under the state where the run-out, maximum value, and minimum value have been held, each peak value can be confirmed.
- 

#### 3.3.2.3 Maximum value peak hold during display of "Max"

Hold the maximum value of fluctuating measurement values according to the following procedure.

When the tolerance judgment condition has been set, the instrument displays the tolerance judgment result for the measured maximum value.

- 1 Quickly press the [MODE] key repeatedly until "Max" is displayed.
- 2 Press the [SET/ZERO] key shortly to blink the "Max" symbol. Then, the maximum value being held is canceled and a new maximum value hold measurement starts.
- 3 When the spindle is displaced, the "Max" symbol changes from blinking to lighting-up and the maximum value is held.

- NOTE**
- Press and hold the [SET/ZERO] key for a long time during measurement in the Preset system. Then, the "INC" symbol lights up and the preset position is canceled. It is possible, thereby, to perform measurement on the basis of the maximum value.(peak zero set)
-



### 3.3.2.4 Minimum value peak hold during display of “Min”


Hold the minimum value of fluctuating measurement values according to the following procedure.

When the tolerance judgment condition has been set, the instrument displays the tolerance judgment result for the measured minimum value.

- 1 Quickly press the [MODE] key repeatedly until “Min” is displayed.
- 2 Press the [SET/ZERO] key shortly to blink the “Min” symbol. Then, the minimum value being held is canceled and a new minimum value hold measurement starts.
- 3 When the spindle is displaced, the “Min” symbol changes from blinking to lighting-up and the minimum value is held.

**NOTE** • Press and hold the [SET/ZERO] key for a long time during measurement in the Preset system. Then, the “INC” symbol lights up and the preset position is canceled. It is possible, thereby, to perform measurement on the basis of the minimum value.(peak zero set)

**TIP** • The difference of display and tolerance judgment in each measurement mode is shown below.

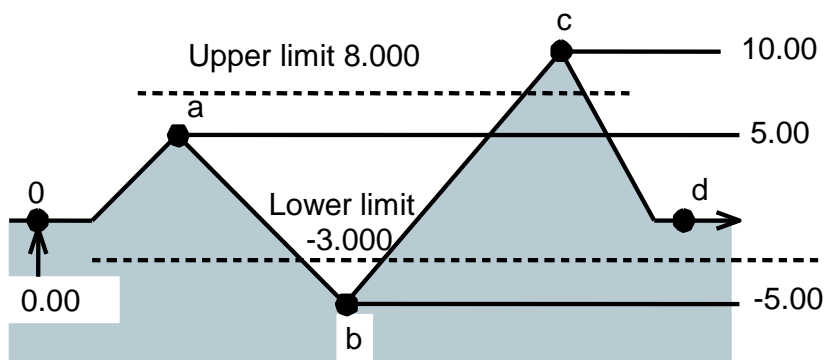

Difference of display in TIR, Max., Min. mode

	0	→	a	→	b	→	c	→	d
Normal	0.00	↗	5.00	↘	-5.00	↗	10.00	↘	0.00
TIR	0.00	↗	5.00	↗	10.00	↗	15.00		
Max.	0.00	↗	5.00			↗	10.00		
Min.	0.00			↘	-5.00				

Difference of tolerance judgment in each mode(Upper limit 8.00, Lower limit -3.00)

	0	a	b	c	d
Normal	○		◀	▶	○
TIR		○		▶	
Max.		○		▶	
Min.	○			◀	

### 3.3.3 Data output / Data hold

Output data to an external device or hold data according to the following procedure.

- 1 Press the [DATA/Fn] key quickly. Data is outputted to an external device if it is connected with the connecting cable.
- 2 Data is held unless an external device is connected.

**TIP**

- For detailed information about data input/output, refer to chapter 4.
- Data hold is available only when the SPC (digimatic) is set.

### 3.3.4 Function lock

To prevent wrong key operation, disable key entries except for peak hold cancel, data output, data hold, and hold cancel according to the following procedure.

- 1 Press and hold the [DATA/Fn] key for a long time in each measurement mode. Then, the "Lock" symbol lights up, putting the instrument in the function lock state.
- 2 To cancel the function lock state, press and hold the [DATA/Fn] key again for a long time. The "Lock" symbol goes off, releasing the instrument from the function lock state.

**NOTE**

- Function lock is canceled automatically when turning off the power of the instrument.

### 3.3.5 Centering the pointer

If the pointer is located outside the analog display range, move the pointer display position to the center of the scale. This centering is the same operation in which the bezel of a dial indicator is shifted around an arbitrary range of the dial scale.

Press the [SET/ZERO] key shortly while holding down the [DATA/Fn] key in each measurement mode to move the pointer to the center of the scale.

**NOTE**

- In the normal measurement mode, locate the pointer so that the current measurement position comes to the center of the scale.
- In the runout hold mode, bring the center position of runout to the center of the scale.
- In the maximum value peak hold mode, bring the center position of the maximum value to the center of the scale.
- In the minimum value peak hold mode, bring the center position of the minimum value to the center of the scale.

## 3.4 Operation with the Remote Control (Option)

This instrument can be operated using the remote control (option).

Name of each remote control switch	Function
SET	INC system (when normal measurement): Zero-setting Preset system (when normal measurement): Preset recalling Each peak hold mode: Canceling peak hold (starting measurement)
DATA	External device connected: Data output External device unconnected: Data hold
MODE	Switching a measurement type in the measurement mode

**NOTE**

- The remote control can identify and operate up to 14 Digimatic indicators in combination by allocating ID No. to each indicator. For information about ID No. setup method of this instrument, refer to section 3.2.6.
- Data hold is available only when the SPC (digimatic) is set.
- In the function lock state, switching zero-setting / presetting / measurement mode is disabled.

---

MEMO

# 4

## DATA INPUT/OUTPUT

This chapter explains the data input/output methods of the Digimatic indicator.

This instrument provides two data communication methods of SPC (Digimatic) input/output and RS-232 input/output. Select one of these methods to use the data communication function.

- IMPORTANT**
- Use only the output cable of Mitutoyo specific accessories. The use of an improper cable or deteriorated cable may disable data output.
  - Prior to data output carefully read the user's manual of the data processing unit to use it correctly.

### 4.1 SPC (Digimatic) Input/Output


Connect this instrument with a data processing unit such as Digimatic Mini Processor DP-1VR using the M-SPC cable (optional accessory) to perform measurement transfer and data processing including tabulation and record.

#### 4.1.1 Connecting procedure


- 1 Switch the input/output format to SPC in the Parameter Setup mode. (Refer to section 3.2.)
- 2 Remove the cap on the I/O connector, and then plug the cable into the connector firmly. (Pack the removed cap in a small bag and store it in a safe place so as not lose it.)

- TIP**
- For the method of switching the input/output format, refer to the section "3.2 Parameter Setup Mode".

#### 4.1.2 I/O connector

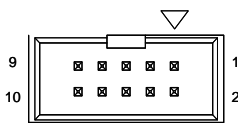


Pin#	Signal	I/O
1	GND	-
2 (*1)	DATA1	O
3 (*1)	$\overline{\text{CK}}$	O
4 (*1)	$\overline{\text{RD}}$	O
5 (*2)	REQ	I
6	(N.C)	-
7	(N.C)	-
8	VDD(5V)	O
9	(N.C)	-
10	GND	-

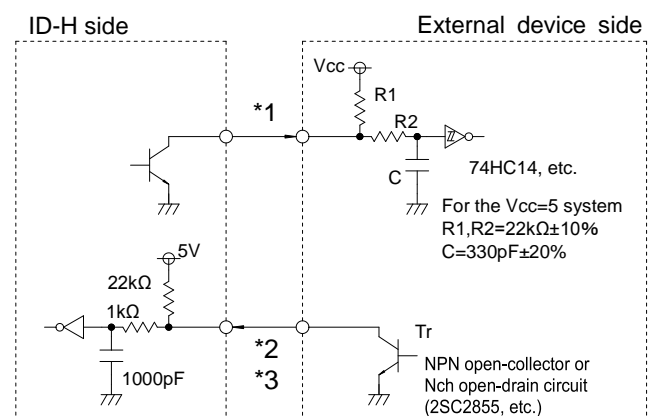


- 
- IMPORTANT**
- Since the power voltage differs between the ID-H and external device sides, absolutely use an open-collector output circuit or open-drain output circuit on the external device side. Do not use a CMOS output circuit.
  - Pin 8 is a terminal dedicated to the RS-232 communication. It is not possible to transmit from the external device or transmit to it.
- 

### 4.1.3 Output data format (DATA1)

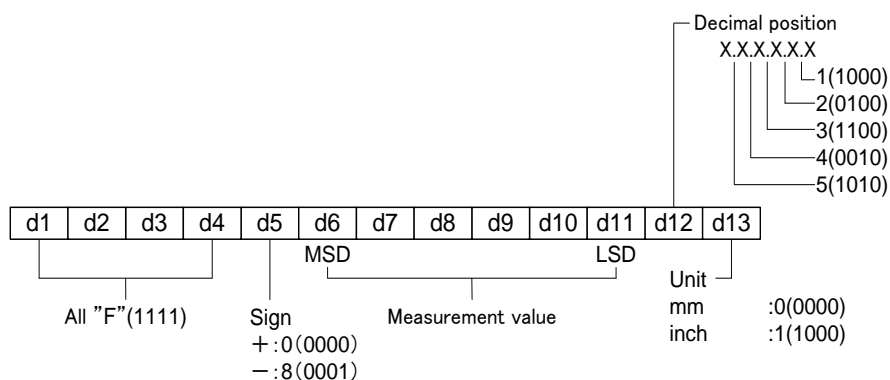

- 
- NOTE**
- Up to 6 digits of numeric values can be outputted as the SPC (Digimatic) output. If the 7 digits of numeric value such as "123.4565mm" is outputted, for example, the instrument output the SPC data as "23.4565mm".
- 

### 4.1.4 Timing chart

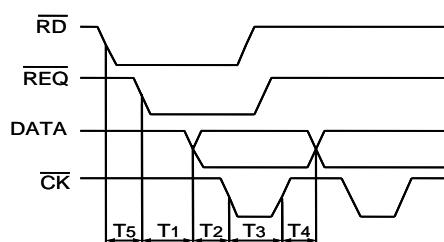

0.7 ms < T1 < 1.2 ms  
100  $\mu$ s < T2 < 200  $\mu$ s  
200  $\mu$ s < T3 < 300  $\mu$ s  
100  $\mu$ s < T4 < 200  $\mu$ s

T5: It depends on the capacity of the data processing device connected.

- 
- IMPORTANT**
- If the output request (REQ) signal is received during the spindle displacement or if the inverter receives output request (REQ) signals repeatedly at short intervals, the instrument may not output data.
- 

- 
- NOTE**
- Retain the REQ signal at Low level until the CK signal is outputted. Also, return the REQ signal to High level before the last CK signal (at the 52nd bit) is outputted.
-

## 4.2 RS-232 Input/Output

Connect this instrument with an external device such as a PC using the RS-232 dedicated cable (optional accessory). With this connection it is possible to perform initial setup of the instrument, control of switching a measurement mode, etc., and processing such as measurement data transfer.

Also, multiple Digimatic indicators can be controlled from one RS-232 port on the external device by setting ID No. on each indicator.

### 4.2.1 Connecting procedure

- 1 Switch the I/O format to RS-232 in the Parameter Setup mode, and then set the communication speed (baud rate), parity, and data bit according to the used external device. (Refer to section 3.2.)
- 2 Replace the input/output connector cap and plug the cable securely. (The replaced cap should be kept in a small bag to prevent losses.)

**NOTE**


- Before a cable is connected with or disconnected, be sure to turn off this instrument.
- If data input/output is not performed properly, there is a possibility of an error in communication setup. Check the settings of this instrument and the connected device.

**TIP**

- For the method of switching the input/output format, refer to the section “3.2 Parameter Setup Mode”.

### 4.2.2 I/O connector

Connector specification: D-sub 9-pin female (receptacle)/inch thread specification

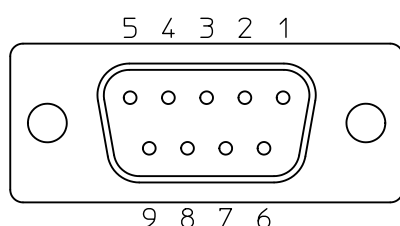

Pin#	Signal	I/O	Definition
1	(N.C)	-	-
2	TxD	O	Transmit data
3	RxD	I	Receive Data
4	DSR	I	Data Set Ready
5	S.G	-	Signal Ground
6	DTR	O	Data Terminal Ready
7	CTS	I	Clear to Send
8	RTS	O	Request to Send
9	(N.C)	-	-

**NOTE**

- The above table lists the pin assignment of the dedicated cable connector.

### 4.2.3 Communication specification

Item	Specification
Home position	DCE (Modem definition), Dedicated cable must be used.
Compliant standard	EIA/TIA-232F (RS-232)
Communication method	Half duplex
Communication speed (bit rate)	4800 or 9600 bps
Data length	7 or 8bit / ASCII / Upper case
Parity control	None, even, or odd
Stop bit	2 bit
Control signal	CTS, DSR, or no control sequence

**TIP**

- For information about the switching method of bit rate, data length, and parity control, refer to section 3.2.5.

## 4.2.4 Communication command (I/O format)

### 1 Measurement command

Operation content		Input (External device -> this instrument)	Output (This instrument -> external device)
Measurement system	Zero-setting (Moves to the INC system)	CR**CRLF	CH**CRLF
	Moves to the Preset system	DS**, PCRLF	DH**, PRESETCRLF (*Refer to the "NOTE" below)
	Preset value setting	CP**, +0016. 2345CRLF	CH**CRLF
	Preset value output	DP**, OUTCRLF	DH**, +0016. 2345CRLF
Measurement mode switching	Normal	CN**CRLF	CH**CRLF
	Max.	CX**CRLF	
	Min.	CM**CRLF	
	TIR (Run-out)	CW**CRLF	
Data output	Normal value	GA**CRLF	GN**, +0016. 2345CRLF
	Max. value		GX**, +0016. 2345CRLF
	Min. value		GM**, -0016. 2345CRLF
	TIR (run-out) value		GW**, +0016. 2345CRLF
Peak hold	Cancel (Peak hold start)	CL**CRLF	CH**CRLF
	Peak zero set	DS**, XM-ZEROCRLF	DH**CRLF
Tolerance judgment	Judgment ON	DJ**, ONCRLF	DH**CRLF
	Judgment cancel	DJ**, OFFCRLF	
	Upper limit value input	CG**, +0016. 2345CRLF	CH**CRLF
	Lower limit value input	CD**, -0016. 2345CRLF	
	Upper limit value output	DJ**, GOUTCRLF	DG**, +0016. 2345CRLF
	Lower limit value output	DJ**, DOUTCRLF	DD**, -0016. 2345CRLF
	Result output (OK)	DJ**, OUTCRLF	DH**, OKCRLF
	Result output (+NG)		DH**, +NGCRLF
	Result output (-NG)		DH**, -NGCRLF
	Status output (under cancel)		DH**, JOFFCRLF
Analog display	Centering	DA**CRLF	DH**CRLF
Function lock	Lock	DF**, LOCKCRLF	DH**CRLF
	Cancel	DF**, FREECRLF	
	Status output (under lock)	DF**, OUTCRLF	DH**, F-LOCKCRLF
	Status output (under cancel)		DH**, F-FREECRLF

### NOTE

- For the detail of each item in the operation content, refer to Chapter 3.
- "CRLF" represents "CR" (carriage return) and "LF" (line feed).
- " \* \*" indicates an ID No. For information about ID No. setup method of this instrument, refer to section 3.2.
- Set an ID No. between 00 and 99.
- Digimatic indicators with a specified ID No. between 01 and 99 can receive and execute a command.

- A Digimatic indicator with the ID No. of 00 can receive and execute a command irrespective of specification of any ID No.
- After power is turned on and moves to the preset system for the first time, the communication command of "DH \* \*, PRESETCRLF" is indicated (at this time, the preset value is not determined). Continue to input the preset value.
- When performing the setting of the preset value in the INC system, the measurement mode is moved to the preset system automatically.
- When moving from the INC system to the preset system, each peak hold mode is canceled.
- Specify a preset value and an upper/lower limit value with 10 digits of sequence including a sign and a decimal point. However, the number next to the sign is fixed to "0". A display value is also outputted with the same sequence.
- For the presetting and the tolerance value setting, input the value and the decimal point position with respect to the resolution.
- "Error $\perp$ 90" judgment is performed by comparing the new tolerance value with the current tolerance value.
- After receiving the output in response to a command, transmit a next command. If there is no response to a command, clear the communication buffer, then transmit the command again after a lapse of one second or more.
- This instrument executes key operation on a top-priority basis. The instrument temporarily stops the RS-232 communication function during key operation, and then executes command and data output upon restoration of the countable state.

### 2 Parameter setup command

Operation content		Input (External device -> this instrument)	Output (This instrument -> external device)
Switching unit	mm	DU**, MMCRLF	DH**CRLF
	inch	DU**, INCRLF	
	Status output (mm)	DU**, OUTCRLF	DH**, MMCRLF
	Status output (inch)		DH**, INCRLF
Switching resolution	0.0005mm	DR**, D0. 000500CRLF	DH**CRLF
	0.001mm	DR**, D0. 001000CRLF	
	.00002"	DR**, D0. 000020CRLF	
	.00005"	DR**, D0. 000050CRLF	
	.0001"	DR**, D0. 000100CRLF	
	Status output	DR**, DOUTCRLF	DH**, D0. 000500CRLF
Switching analog range	Range setting	DR**, A##CRLF	DH**CRLF
	Status output	DR**, AOUTCRLF	DH**, A##CRLF
Switching count direction	+ direction	DD**, NORMCRLF	DH**CRLF
	- (rev.) direction	DD**, REVCRLF	
	Status output (+)	DD**, OUTCRLF	DH**, NORMCRLF
	Status output (-)		DH**, REVCRLF
Setup when startup	Start setting (INC)	DS**, SINCRLF	DH**CRLF
	Start setting (Setup during stop)	DS**, SFREECRLF	
Measurement system/Setup output when startup	INC / INC start	DS**, OUTCRLF	DH**, INC-SINCRLF
	INC / start during stop		DH**, INC-SFREECRLF
	P / INC start		DH**, P-SINCRLF
	P / start during stop		DH**, P-SFREECRLF
Return initial setting		DE * *, RESETCRLF	DE**, RESETCRLF



---

**IMPORTANT** • For the “Initial setting” by RS-232 input, setting of both “Input/output format” and “ID No.” are retained.

---

**NOTE** • For the detail of each item in the operation content, refer to Chapter 3.  
 • “A##” indicates the setting command of the analog range. For information about the analog range, refer to section 3.2.3. Switching the analog range (analog resolution) during display of “range”

---

### 3 Error command

Operation content		Input (External device -> this instrument)	Output (This instrument -> external device)
Error	Over-speed	—	CH**, Error␣20CRLF
	Overflow		CH**, Error␣30CRLF
	Communication command error		CH**, Error␣52CRLF
	Tolerance setup error		CH**, Error␣90CRLF
	Preset value error		CH**, Error␣95PCRLF
	Upper limit value error		CH**, Error␣ 95GCRLF
	Lower limit value error		CH**, Error␣95DCRLF
	Cancel	CS**CRLF	CH**CRLF

---

**NOTE** • “␣” indicates a space.  
 • For detailed information about errors, refer to “5 ERROR MESSAGE AND ACTION”.

---

## 4.2.5 Communication sample

The example of RS-232 communication by using the hyper terminal (attached in the Windows) is described below.

- 1 Start up the hyper terminal and select the setting of the digimatic indicator (ID-H side) to the “Port setting”.

It is also possible to select “Port setting” by clicking on “File” → “Properties” → “Connect to” and press the “Configure...” button.

When it is necessary to set the initial setting, set “Port setting” as follows.

“Bits per second”: 9600bps, “Data bit”: 7bit, “Parity”: even

“Stop bits”: 2bit, “Flow control”: Hardware

- 2 Continue to select some of the settings for the hyper terminal.

Click on “File” → “Properties” → “Settings” to change the setting as follows.

「Emulation」: ANSI

Click on “ASCII setup” to put the checking mark for check boxes: “Send line ends with line feeds”, “Echo typed characters locally”, “Append line feeds to incoming line ends” and “Wrap lines that exceed terminal width”.

- 3 Example of communication

The procedure below is the case when the tolerance judgment is performed after presetting

+12.3455mm and setting the upper limit for 12.35mm and the lower limit 12.34mm in the preset system. For this time, ID No. is "00" (default).

- (1) Perform presetting: Input the command "CP00,+0012.3455" from PC. This instrument performs presetting and responds the command "CH00".
- (2) Set Upper limit: Input the command "CG00,+0012.3500" from PC. This instrument sets the upper limit and responds the command "CH00".
- (3) Set Lower limit: Input the command "CD00,+0012.3400" from PC. This instrument sets the lower limit and responds the command "CH00".
- (4) Set the tolerance judgment mode. Input the command "DJ00,ON" from PC. This instrument changes the measurement mode to the tolerance judgment mode and responds the command "DH00".

- 
- TIP**
- For the example of RS-232 communication described above, perform presetting (change of the measurement system) at the beginning. This instrument changes the upper and the lower limit of the measurement mode when inputting the command.
  - For the procedure (2) to (4), it is allowed to proceed with the random order.
  - When using the hyper terminal, it is not possible to correct the command typing error. Once input the incorrect command (this instrument responds the command "CH\*\*,Error□52") and then input the correct command.
-

---

MEMO

# 5

## ERROR MESSAGE AND ACTION

This chapter describes the error messages and their corrective actions.

If any error occurs in this Digimatic indicator, a corresponding error message is displayed. (While RS-232 communication is being performed, an error message is also outputted. In the Digimatic code output mode an error message will not be outputted.)

If the instrument does not recover the normal conditions after corrective actions, contact your dealer or Mitutoyo sales office.

### 1. Errors possibly caused in normal operation

Message	RS-232 output	Definition	Action
<b>Error20</b>	Error20	Over-speed • The spindle operation speed has exceeded the response speed of this instrument.	<ul style="list-style-type: none"> <li>• Press the [SET/ZERO] key.</li> <li>• Use this instrument at a speed so that the spindle operation speed is within the response speed.</li> </ul>
<b>Error30</b>	Error30	Display overflow • The display value has exceeded the maximum number of digits that can be displayed.	<ul style="list-style-type: none"> <li>• Return the display value to the permissible number of digits to automatically reset the error.</li> <li>• Press the [SET/ZERO] key quickly or hold it down slowly. *1</li> <li>• Enter the setup mode with the [MODE] key, and then reduce the resolution. *2</li> </ul>
(Normal count)	Error52	RS-232 command input error • A wrong command was inputted.	<ul style="list-style-type: none"> <li>• Re-enter the correct command.</li> </ul>
<b>Error90</b>	Error90	Tolerance setup error • The limit values are set so as to be an upper limit value < a lower limit value.	<ul style="list-style-type: none"> <li>• Press the [SET/ZERO] key quickly, and then set tolerance limit values so as to be an upper limit value &gt; a lower limit value.</li> </ul>
<b>Error<sup>P</sup>95</b>	Error95P	Preset value setting error • The preset value has over flown.	<ul style="list-style-type: none"> <li>• Set a preset value again. *3</li> <li>• Reduce the resolution. *3</li> </ul>
<b>Error<sup>▶</sup>95</b>	Error95G	Upper limit value setting error • The upper limit value has over flown.	<ul style="list-style-type: none"> <li>• Set an upper limit value again. *4</li> <li>• Reduce the resolution. *3</li> </ul>
<b>Error<sup>◀</sup>95</b>	Error95D	Lower limit value setting error • The lower limit value has over flown.	<ul style="list-style-type: none"> <li>• Set a lower limit value again. *4</li> <li>• Reduce the resolution. *3</li> </ul>

\*1. Press the [SET/ZERO] key quickly (less than 2 seconds) to switch to the Preset Setup mode, or press and hold the key slowly (2 seconds or more) to perform zero-setting in the INC measurement system.

- 
- \*2. Press and hold the [MODE] key slowly to switch to the Parameter Setup mode.
  - \*3. Press the [MODE] key quickly to clear the error using the procedure in \*1 and \*2 "Error 30" message.
  - \*4. Press and hold the [MODE] key slowly to blink the "<O>" symbol and make tolerance setup ready, or press and hold the [SET/ZERO] key slowly to display a maximum permissible display value and set tolerance limit values.

- 
- NOTE**
- If data input/output is not performed properly, there is a possibility of an error in communication setup. Check the settings of this instrument and the connected device.
  - For detailed information about the RS-232 output command, refer to section 4.2.
  - If any of the above errors occurs during function lock, press and hold the [DATA/Fn] key for 2 seconds or more to cancel the function lock, and then perform the error clear processing.
-

# 6

## SPECIFICATION

### 6.1 Specifications of the main unit

Model name Order No. *1	ID-H0530 543-561-1	ID-H0560 543-563-1	ID-H0530E 543-562-1	ID-H0560E 543-564-1
Resolution	0.0005mm / 0.001mm		0.0005mm / 0.001mm .00002" / .00005" / .0001"	
Measuring range	30.48mm	60.96mm	30.48mm = 1.2"	60.96mm = 2.4"
Accuracy (20°C) *2	0.0015mm or less	0.0025mm or less	0.0015mm = .00006" or less	0.0025mm = .0001" or less
Standards Stem diameter Contact point	ISO R463 / JIS B7503 / DIN 878 φ 8mm Carbide SR1.5 (M2.5x0.45)		ANSI B89.1.10 / AGD φ 9.52mm = 3/8"DIA Carbide SR1.5 (#4-48UNF)	
Contact force	2.0N or less	2.5N or less	2.0N or less	2.5N or less
Maximum response speed	1000mm/sec			
Protection	Equivalent IP-30 (at conditions ex-works) Protection level according to IEC60529 / JIS D0207, C0920.			
Plunger direction	Below the horizon			
Power supply	AC adapter (6V, 2A)			
Consumption current	200mA or less			
Operating temp	0°C ~ 40°C			
Storage temp	-10°C ~ 60°C			
Net weight	Approx. 305g (0.67 lbs)	Approx. 290g (0.63 lbs)	Approx. 305g (0.67 lbs)	Approx. 290g (0.63 lbs)

\*1 : This Order No. mean only the main unit without AC adapter.

\*2 : Not including the quantizing error.

### 6.2 Standard accessories

- # 99MAH016B User's manual
- # 99MAH018B Quick reference manual
- # 137693 Lifting lever
- # 21EAA150 Clamp filter
- # 06AEG180JA AC adapter (100-240V : Japan, USA, Canada, & Co.)
- # 06AEG180D AC adapter (100-240V : Germany, & Co.)
- # 06AEG180E AC adapter (100-240V : UK, & Co.)
- # 06AEG180K AC adapter (100-240V : Korea, for KC)
- # 06AEG180DC AC adapter (100-240V : China, for CCC)

Certification of inspection

---

## 6.3 Optional accessories

---

#21EZA099	Remote Controller
#540774	Spindle Lifting cable
#21EZA101	Lifting knob
#936937	M-SPC cable 1m/40"
#965014	M-SPC cable 2m/80"
#21EAA131	RS-232 cable 2m/80"
#101040	Lug-on-center back (for ISO/JIS model)
#101306	Lug-on-center back (for ANSI/AGD model)

# SERVICE NETWORK

\*As of October 2013

## Europe

### Mitutoyo Europe GmbH

Borsigstrasse 8-10, 41469 Neuss, GERMANY  
TEL:49(2137)102-0 FAX:49(2137)102-351

### Mitutoyo CTL Germany GmbH

Neckarstrasse 1/8, 78727 Oberndorf, GERMANY  
TEL:49(7423) 8776-0 FAX:49(7423)8776-99

### KOMEГ Industrielle Messtechnik GmbH

Zum Wasserwerk 3, 66333 Völklingen, GERMANY  
TEL: 49(6898)91110 FAX: 49(6898)911100

## Germany

### Mitutoyo Deutschland GmbH

Borsigstrasse 8-10, 41469 Neuss, GERMANY  
TEL:49(2137)102-0 FAX:49(2137)86 85

### M3 Solution Center Hamburg

Tempowerkring 9 im HIT-Technologiepark 21079 Hamburg, GERMANY  
TEL:49(40)791894-0 FAX:49(40)791894-50

### M3 Solution Center Leonberg GmbH

Steinbeisstrasse 2, 71229 Leonberg, GERMANY  
TEL:49(7152)6080-0 FAX:49(7152)608060

### M3 Solution Center Berlin

Paradiesstrasse 208, 12526 Berlin, GERMANY  
TEL:49(30)2611 267 FAX:49(30)26 29 209

### M3 Solution Center Eisenach

im tbz Eisenach, Heinrich-Ehrhardt-Platz, 99817 Eisenach, GERMANY  
TEL:49(3691)88909-0 FAX:49(3691)88909-9

### M3 Solution Center Ingolstadt

Marie-Curie-Strasse 1a, 85055 Ingolstadt, GERMANY  
TEL:49(841)954920 FAX:49(841)9549250

### Mitutoyo-Messgeräte Leonberg GmbH

Heidenheimer Strasse 14, 71229 Leonberg, GERMANY  
TEL:49(7152)9237-0 FAX:49(7152)9237-29

## U.K.

### Mitutoyo (UK) Ltd.

Joule Road, West Point Business Park, Andover, Hampshire SP10 3UX,  
UNITED KINGDOM TEL:44(1264)353123 FAX:44(1264)354883

### M3 Solution Center Coventry

Unit6, Banner Park, Wickmans Drive, Coventry, Warwickshire CV4 9XA,  
UNITED KINGDOM TEL:44(2476)426300 FAX:44(2476)426339

### M3 Solution Center Halifax

Lowfields Business Park, Navigation Close, Elland, West Yorkshire HX5 9HB,  
UNITED KINGDOM TEL:44(1422)375566 FAX:44(1422)328025

### M3 Solution Center East Kilbride

The Baird Bulding, Rankine Avenue, Scottish Enterprise Technology Park, East  
Kilbride G75 0QF, UNITED KINGDOM  
TEL:44(1355)581170 FAX:44(1355)581171

## France

### Mitutoyo France

Paris Nord 2-123 rue de la Belle Etoile, BP 59267 ROISSY EN FRANCE 95957  
ROISSY CDG CEDEX, FRANCE TEL:33(1) 49 38 35 00 FAX:33(1) 48 63 27 70

### M3 Solution Center LYON

Parc Mail 523, cours du 3ème millénaire, 69791 Saint-Priest, FRANCE  
TEL:33(1) 49 38 35 70 FAX:33(1) 49 38 35 79

### M3 Solution Center STRASBOURG

"Parc Mail" 523, cours du 3ème millénaire, 69791 Saint-Priest Cedex, FRANCE  
TEL:33(1) 49 38 35 80 FAX:33(1) 49 38 35 89

### M3 Solution Center CLUSES

Espace Scionzier 480 Avenue des Lacs, 74950 Scionzier, FRANCE  
TEL:33(1) 49 38 35 90 FAX:33(1) 49 38 35 99

### M3 Solution Center TOULOUSE

Aeroparc Saint-Martin ZAC de Saint Martin du Touch 12 rue de Caulet, 31300  
Toulouse, FRANCE TEL:33 (5) 82 95 60 69

## Italy

### MITUTOYO ITALIANA S.r.l.

Corso Europa, 7 - 20020 Lainate (MI), ITALY  
TEL: 39(02)935781 FAX:39(02)9373290-93578255

### M3 Solution Center VERONA

Via A. Volta, 37062 Dosso Buono (VR), ITALY  
TEL:39(045)513012 FAX:39(045)8617241

### M3 Solution Center TORINO

Via Brandizzo, 133/F - 10088 Volpiano (TO), ITALY  
TEL:39(0)11 9123995 FAX:39(0)11 9953202

### M3 Solution Center CHIETI

Contrada Santa Calcagna - 66020 Rocca S. Giovanni (CH), ITALY  
TEL/FAX:39(0872)709217

## Netherlands

### Mitutoyo Nederland B.V.

Storkstraat 40, 3905 KX Veenendaal, THE NETHERLANDS  
TEL:31(0)318-534911 FAX:31(0)318-534811

### Mitutoyo Research Center Europe B.V.

De Rijn 18, 5684 PJ Best, THE NETHERLANDS  
TEL:31(0)499-320200 FAX:31(0)499-320299

## Belgium

### Mitutoyo Belgium N.V.

Hogenakkerhoek straat 8, 9150 Kruibeke, BELGIUM  
TEL:32(0)3-2540444 FAX:32(0)3-2540445

## Sweden

### Mitutoyo Scandinavia AB

Släntvägen 6, 194 54 Upplands Väsby, SWEDEN  
TEL:46(0)8 594 109 50 FAX:46(0)8 590 924 10

### M3 Solution Center Alingsas

Kristineholmsvägen 26, 441 39 Alingsas, SWEDEN

TEL:46(0)8 594 109 50 FAX:46(0)322 63 31 62

### M3 Solution Center Värnamo

Storgatsbacken 9, 331 30 Värnamo, SWEDEN  
TEL:46(0)8 594 109 50 FAX:46(0)370 463 34

## Finland

### Mitutoyo Scandinavia AB Finnish Branch

Viherkiitäjä 2A, FI-33960, Pirkkala, Finland  
TEL: +358 207 929 640

## Switzerland

### Mitutoyo Schweiz AG

Steinackerstrasse 35, 8902 Urdorf, SWITZERLAND  
TEL:41(0)447361150 FAX:41(0)447361151

## Poland

### Mitutoyo Polska Sp.z o.o.

ul.Minska 54-56, 54-610 Wroclaw, POLAND  
TEL:48(71)354 83 50 FAX:48(71)354 83 55

## Czech Republic

### Mitutoyo Cesko, s.r.o.

Dubská 1626, 415 01 Teplice, CZECH REP  
TEL:420-417-579-866 FAX:420-417-579-867

## Hungary

### Mitutoyo Hungária Kft.

Németvölgyi út 97, H-1124 Budapest, HUNGARY  
TEL:36(1)2141447 FAX:36(1)2141448

## Romania

### Mitutoyo Romania SRL

1A, Drumul Garii Odai Street, Ground Floor, Room G03, 075100  
OTOPENI-ILFOV, ROMANIA TEL:40(0)311012088 FAX:40(0)311012089

## Russian Federation

### Mitutoyo RUS LLC

13 Sharikopodshipnikovskaya, bld.2, 115088 Moscow, RUSSIAN FEDERATION  
TEL:(7)495 7450 752 FAX:(7)495 745 0752

### Mitutoyo Austria GmbH

Johann Roithner Straße 131 A-4050 Traun  
TEL:+43(0)7229/23850 FAX:+43(0)7229/23850-90

## Singapore

### Mitutoyo Asia Pacific Pte. Ltd.

#### Head office / M3 Solution Center

24 Kallang Avenue, Mitutoyo Building, SINGAPORE 339415  
TEL:(65)62942211 FAX:(65)62996666

## Malaysia

### Mitutoyo (Malaysia) Sdn. Bhd.

#### Kuala Lumpur Head Office / M3 Solution Center

Mah Sing Intergrated Industrial Park, 4, Jalan Utarid U5/14, Section U5, 40150  
Shah Alam, Selangor, MALAYSIA TEL:(60)3-78459318 FAX:(60)3-78459346

#### Penang Branch office / M3 Solution Center

No.30, Persiaran Mahsuri 1/2, Sunway Tunas, 11900 Bayan Lepas, Penang,  
MALAYSIA TEL:(60)4-6411998 FAX:(60)4-6412998

#### Johor Branch office / M3 Solution Center

No. 70, Jalan Molek 1/28, Taman Molek, 81100 Johor Bahru, Johor, MALAYSIA  
TEL:(60)7-3521626 FAX:(60)7-3521628

## Thailand

### Mitutoyo(Thailand)Co., Ltd.

#### Bangkok Head Office / M3 Solution Center

No. 76/3-5, Chaengwattana Road, Anusaowaree, Bangkaen, Bangkok 10220,  
THAILAND TEL:(66)2-521-6130 FAX:(66)2-521-6136

#### Cholburi Branch / M3 Solution Center

No.7/1, Moo 3, Tambon Bowin, Amphur Sriracha, Cholburi 20230, THAILAND  
TEL:(66)3-834-5783 FAX:(66)3-834-5788

#### Amata Nakorn Branch / M3 Solution Center

No. 700/199, Moo 1, Tambon Ban Kao, Amphur Phan Thong, Cholburi 20160,  
THAILAND TEL:(66)3-846-8976 FAX:(66)3-846-8978

## Indonesia

### PT. Mitutoyo Indonesia

#### Head Office / M3 Solution Center

Ruko Mall Bekasi Fajar Blok A6&A7 MM2100 Industrial Town, Cikarang Barat,  
Bekasi 17520, INDONESIA TEL:(62)21-8980841 FAX:(62)21-8980842

## Vietnam

### Mitutoyo Vietnam Co., Ltd

#### Hanoi Head Office / M3 Solution Center

No.34-TT4, My Dinh-Me Tri Urban Zone, My Dinh Commune, Tu Liem District,  
Hanoi, VIETNAM TEL:(84)4-3768-8963 FAX:(84)4-3768-8960

#### Ho Chi Minh City Branch Office / M3 Solution Center

31 Phan Xich Long Street, Ward 2, Phu Nhuan District, Ho Chi Minh City,  
VIETNAM TEL:(84)8-3517-4561 FAX:(84)8-3517-4582

## India

### Mitutoyo South Asia Pvt. Ltd.

#### Head Office / M3 Solution Center

C-122, Okhla Industrial Area, Phase-1, New Delhi-110 020, INDIA  
TEL:91(11)2637-2090 FAX:91(11)2637-2636

#### Mumbai Region Head office

303, Sentinel Hiranandani Business Park Powai, Mumbai-400 076, INDIA  
TEL:91(22)2570-0684, 837, 839 FAX:91(22)2570-0685

#### Pune Office / M3 Solution Center

G2/G3, Pride Kumar Senate, F.P. No. 402 Off. Senapati Bapat Road, Pune-411 016,  
INDIA TEL:91(20)6603-3643, 45, 46 FAX:91(20)6603-3644

#### Vadodara office

S-1&S-2, Olive Complex, Nr. Haveli, Nizampura, Vadodara-390 002, INDIA

TEL: (91) 265-2750781 FAX: (91) 265-2750782

#### Bengaluru Region Head office / M3 Solution Center

No. 5, 100 Ft. Road, 17th Main, Koramangala, 4th Block, Bengaluru-560 034,  
INDIA TEL:91(80)2563-0946, 47, 48 FAX:91(80)2563-0949



# SERVICE NETWORK

\*As of October 2013

## Chennai Office / M3 Solution Center

No. 624, Anna Salai Teynampet, Chennai-600 018, INDIA  
TEL:91(44)2432-8823, 24, 27, 28 FAX:91(44)2432-8825

## Kolkata Office

Unit No. 1208,Om Tower, 32,J.L.Nehru Road, Kolkata-700 071, INDIA  
Tel: (91) 33-22267088/40060635 Fax: (91) 33-22266817

## Taiwan

### Mitutoyo Taiwan Co., Ltd.

4F., No.71, Zhouzi St., Neihsu Dist.,Taipei City 114, TAIWAN (R.O.C.)  
TEL:886(2)8752-3266 FAX:886(2)8752-3267

### Taichung Branch

16F.-3, No.6, Ln.256, Sec.2, Xitun Rd., Xitun Dist., Taichung City 407, TAIWAN (R.O.C.) TEL:886(4)2707-1766 FAX:886(4)2451-8727

### Kaohsiung Branch

13F.-3, No.31, Haibian Rd., Lingya Dist., Kaohsiung City 802, TAIWAN (R.O.C.)  
TEL:886(7)334-6168 FAX:886(7)334-6160

### M3 Solution Center Taipei

4F., No.71, Zhouzi St., Neihsu Dist., Taipei City 114,TAIWAN (R.O.C.)  
TEL:886(2)8752-3266 FAX:886(2)8752-3267

### M3 Solution Center Tainan

Rm.309, No.31, Gongye 2nd Rd., Annan Dist., Tainan City 709, TAIWAN (R.O.C.)  
TEL:886(6)384-1577 FAX:886(6)384-1576

## South Korea

### Mitutoyo Korea Corporation

#### Head Office / M3 Solution Center

(Sanbon-Dong, Geumjeong High View Build.), 6F, 153-8, Ls-Ro, Gunpo-Si, Gyeonggi-Do, 435-040 KOREA TEL:82(31)361-4200 FAX:82(31)361-4202

#### Busan Office / M3 Solution Center

Donghum Build. 1F, 559-13 Gwaebop-Dong, Sasang-Gu, Busan, 617-809, KOREA  
TEL:82(51)324-0103 FAX:82(51)324-0104

#### Daegu Office / M3 Solution Center

371-12, Hosan-Dong, Dalseo-Gu, Daegu, 704-230, KOREA  
TEL:82(53)593-5602 FAX:82(53)593-5603

## China

### Mitutoyo Measuring Instruments (Shanghai) Co., Ltd.

12F, Nextage Business Center, No.1111 Pudong South Road, Pudong New District ,Shanghai 200120, CHINA TEL:86(21)5836-0718 FAX:86(21)5836-0717

### Suzhou Office / M3 Solution Center China (Suzhou)

No. 46 Baiyu Road, Suzhou 215021, CHINA  
TEL:86(512)6522-1790 FAX:86(512)6251-3420

### Wuhan Office

RM. 1206B Wuhan World Trade Tower, No. 686, Jiefang Ave, Jiangnan District, Wuhan 430032, CHINA TEL:86(27)8544-8631 FAX:86(27)8544-8227

### Chengdu Office

1-705, New Angle Plaza, 668# Jindong Road, Jinjiang District, Chengdu, Sichuan 610066, CHINA TEL:86(28)8671-8936 FAX:86(28)8671-9086

### Hangzhou Office

RM. A+B+C 15/F, TEDA Building, No.256 Jie-fang Nan Road Hexi District,Tianjin 300042, CHINA TEL:86(22)5888-1700 FAX:86(22)5888-1701

### Tianjin Office / M3 Solution Center Tianjin

No.16 Heiniucheng-Road, Hexi-District, Tianjin 300210, CHINA  
TEL:86(22)8558-1221 FAX:86(22)8558-1234

### Changchun Office

RM.1801, Kaifa Dasha, No. 5188 Ziyou Avenue, Changchun 130013, CHINA  
TEL:86(431)8461-2510 FAX:86(431)8464-4411

### Qingdao Office / M3 Solution Center Qingdao

No.135-10, Fuzhou North Road, Shibei District, Qingdao City, Shandong 266034, CHINA TEL:86(532)8066-8887 FAX:86(532)8066-8890

### Xi'an Office

RM. 805, Xi'an International Trade Center, No. 196 Xiaozhai East Road, Xi'an, 710061, CHINA TEL:86(29)8538-1380 FAX:86(29)8538-1381

### Dalian Office / M3 Solution Center Dalian

RM.1008, Grand Central IFC, No.128 Jin ma Road,Economic Development Zone,Dalian 116600, CHINA TEL:86(411)8718 1212 FAX:86(411)8754-7587

### Zhengzhou Office

Room1801,18/F,Unit1,Building No.23, Shangwu Inner Ring Road, Zhengdong New District,Zhengzhou City, Henan Province, 450018,CHINA

TEL:86(371)6097-6436 FAX:86(371)6097-6981

### Mitutoyo Leepport Metrology (Hong Kong) Limited

Rm 818, 8/F, Vanta Industrial Centre, No.21-33, Tai Lin Pai Road, Kwai Chung, NT, Hong Kong TEL:86(852)2992-2088 FAX:86(852)2670-2488

### Mitutoyo Leepport Metrology (Dongguan) Limited / M3 Solution Center Dongguan

No.26, Guan Chang Road, Chong Tou Zone, Chang An Town, Dong Guan, 523855 CHINA TEL:86(769)8541 7715 FAX:86(769)-8541 7745

### Mitutoyo Leepport Metrology (Dongguan) Limited – Fuzhou office

Rm 2104, City Commercial Centre, No.129 Wu Yi Road N., Fuzhou City, Fujian Province, CHINA TEL (86) 0591 8761 8095 FAX (86) 0591 8761 8096

### Mitutoyo Leepport Metrology (Dongguan) Limited – Changsha office

Rm 2121, Dingwang Building, No.88, Section 2, Furong Middle Road, Changsha City, Hunan Province, CHINA TEL (86) 731 8872 8021 FAX (86) 731 8872 8001

### Mitutoyo Measuring Instruments (Suzhou) Co., Ltd.

No. 46 Baiyu Road, Suzhou 215021, CHINA  
TEL:86(512)6252-2660 FAX:86(512)6252-2580

## U.S.A.

### Mitutoyo America Corporation

965 Corporate Blvd., Aurora, IL 60502, U.S.A.  
TEL:1-(630)820-9666 Toll Free No. 1-888-648-8869 FAX:1-(630)820-2614

### M3 Solution Center-Illinois

945 Corporate Blvd., Aurora, IL 60502, U.S.A.

### M3 Solution Center-Ohio

6220 Hi-Tek Ct., Mason, OH 45040, U.S.A.  
TEL:1-(513)754-0709 FAX:1-(513)754-0718

## M3 Solution Center-Michigan

44768 Helm Street, Plymouth, MI 48170, U.S.A.  
TEL:1-(734)459-2810 FAX:1-(734)459-0455

## M3 Solution Center-California

16925 E. Gale Ave., City of Industry, CA 91745, U.S.A.  
TEL:1-(626)961-9661 FAX:1-(626)333-8019

## M3 Solution Center-Massachusetts

1 Park Dr., Suite 11, Westford, MA 01886, U.S.A.  
TEL:1-(978)692-8765 FAX:1-(978)692-9729

## M3 Solution Center-North Carolina

11515 Vanstory Dr., Suite 150, Huntersville, NC 28078, U.S.A.  
TEL:1-(704)875-8332 FAX:1-(704)875-9273

## M3 Solution Center-Alabama

2100 Riverchase Center Suite 106 Hoover, AL 35244, U.S.A  
TEL:1-(205)-988-3705 FAX:1-(205)-988-3423

## CT-Lab Chicago

965 Corporate Blvd., Aurora, IL 60502, U.S.A.  
TEL:1-630-820-9666 FAX:1-630-820-2614

## Micro Encoder, Inc.

11533 NE 118th St., bldg. M, Kirkland, WA 98034, U.S.A.  
TEL:1-(425)821-3906 FAX:1-(425)821-3228

## Micro Encoder Los Angeles, Inc.

16925 E. Gale Ave. City of Industry, CA 91745 USA  
TEL:1-626-961-9661 FAX:1-626-333-8019

## Canada

### Mitutoyo Canada Inc.

2121 Meadowvale Blvd., Mississauga, Ont. L5N 5N1., CANADA  
TEL:1-(905)821-1261 FAX:1-(905)821-4968

### Montreal Office

7075 Place Robert-Joncas Suite 129, Montreal, Quebec H4M 2Z2, CANADA  
TEL:1-(514)337-5994 FAX:1-(514)337-4498

## Brazil

### Mitutoyo Sul Americana Ltda.

AV. Joao Carlos da Silva Borges, 1240 - CEP 04726-002 - Santo Amaro - São Paulo - SP, BRASIL TEL:55(11)5643-0000 FAX:55(11)5641-3722

### Regional Office

Belo Horizonte - MG  
TEL:55(31)3531-5511 FAX:55(31)3594-4482

### Rio Grande do Sul / PR, SC

TEL/FAX:55(51)3342-1498 TEL:55(51)3337-0206

### Rio de Janeiro - RJ

TEL:55(21)3333-4899 TEL/FAX:55(21)2401-9958

### Santa Barbara D'Oeste - SP

TEL:55(19)3455-2062 FAX:55(19)3454-6103

### Norte, Nordeste, Centro Oeste

TEL:55(11)5643-0060 FAX:55(11)5641-9029

### Escritorio BA / SE

TEL/FAX:55(71)3326-5232

### Factory(Suzano)

Rodovia Indio Tibirica 1555, BAIRRO RAFFO, CEP 08620-000 SUZANO-SP, BRASIL TEL:55(11)4746-5858 FAX:55(11)4746-5936

## Argentina

### Mitutoyo Sul Americana Ltda.

#### Argentina Branch

Av. B. Mitre 891/899 – C.P. (B1603CQD) Vicente López –Pcia. Buenos Aires – Argentina TEL:54(11)4730-1433 FAX:54(11)4730-1411

#### Sucursal Cordoba

Av. Amadeo Sabattini, 1296, esq. Madrid B° Crisol Sur – CP 5000, Cordoba, ARGENTINA TEL/FAX:54 (351) 456-6251

## Mexico

### Mitutoyo Mexicana, S. A. de C. V

Prolongación Industria Eléctrica No. 15 Parque Industrial Naucalpan Naucalpan de Juárez, Estado de México C.P. 53370, MÉXICO

TEL: 52 (01-55) 5312-5612, FAX: 52 (01-55) 5312-3380

### M3 Solution Center Monterrey

Av. Morones Prieto No 914. Ote., Local 105 - Plaza Malz Col. La Huerta, C.P. 67140 Guadalupe, N.L., México

TEL: 52 (01-81) 8398-8228, 8398-8227 and 8398-8244 FAX: 52 (01-81) 8398-8226

### M3 Solution Center Tijuana

Av. 2o. eje Oriente-Poniente No. 19075 Int. 18 Col. Cd. Industrial Nueva Tijuana C.P. 22500 Tijuana, B. C., México

TEL: 52 (01-664) 624-3644 and 624-3645 FAX: 52 (01-664) 647-5024

### M3 Solution Center Querétaro

Acceso "C" No. 107 Col. Parque Industrial Jurica C.P. 76100 Querétaro, Qro., México

TEL: 52 (01-442) 340-8018, 340-8019 and 340-8020 FAX: 52 (01-442) 340-8017

### Aguascalientes Office / M3 Solution Center

Av. Aguascalientes No. 622, Local 12 Centro Comercial El Cilindro Fracc. Pulgas Pandas Norte, C.P. 20138, Aguascalientes, Ags. México

TEL: 52 (01-449) 174-4140 FAX: 52 (01-449) 174-4143

### Irapuato Office / M3 Solution Center

Av. Héroes de Nacozari No. 1655, local A-14 esq. con Boulevard Villas de Irapuato "Plaza Delta" Col. San Miguelito, C.P. 36557 Irapuato. Gto., México

TEL: 52 (01-462) 144-1200